


ALWAYS INCLUDE
SERIAL NO. OF
PLOW WHEN
ORDERING PARTS

ITEM	PART #	REQ'D.	DESCRIPTION
1	14791-A	3	TORSION SPRING
2	11689-B	SEE PLOW MOD. ABOVE	CUTTING EDGE BACKER 36"
3	11690-B	SEE PLOW MOD. ABOVE	CUTTING EDGE BACKER 48"
4	5175-A125	3	PIN W/COTTERS
5	5175-A126	6	PIN W/COTTERS
6	12787-BA	1	MLBD. SUPPORT BAR
7	11685-A2	1	TOP. SECURING PIN W/COTTER
8	14128-A5	1	BOTTOM-SECURING PIN W/COTTER
9	6511-A1	1-R,1-L	CURB SHOE
10	5308-A185		CARRIAGE BOLT 5/8"NC X 2-1/2"
11	5308-A2		CARRIAGE BOLT 5/8"NC X 2"
12	1935-A3	1	LONG-SECURING PIN W/COTTER
13	1939-A4	4	SHORT-SECURING PIN W/COTTER

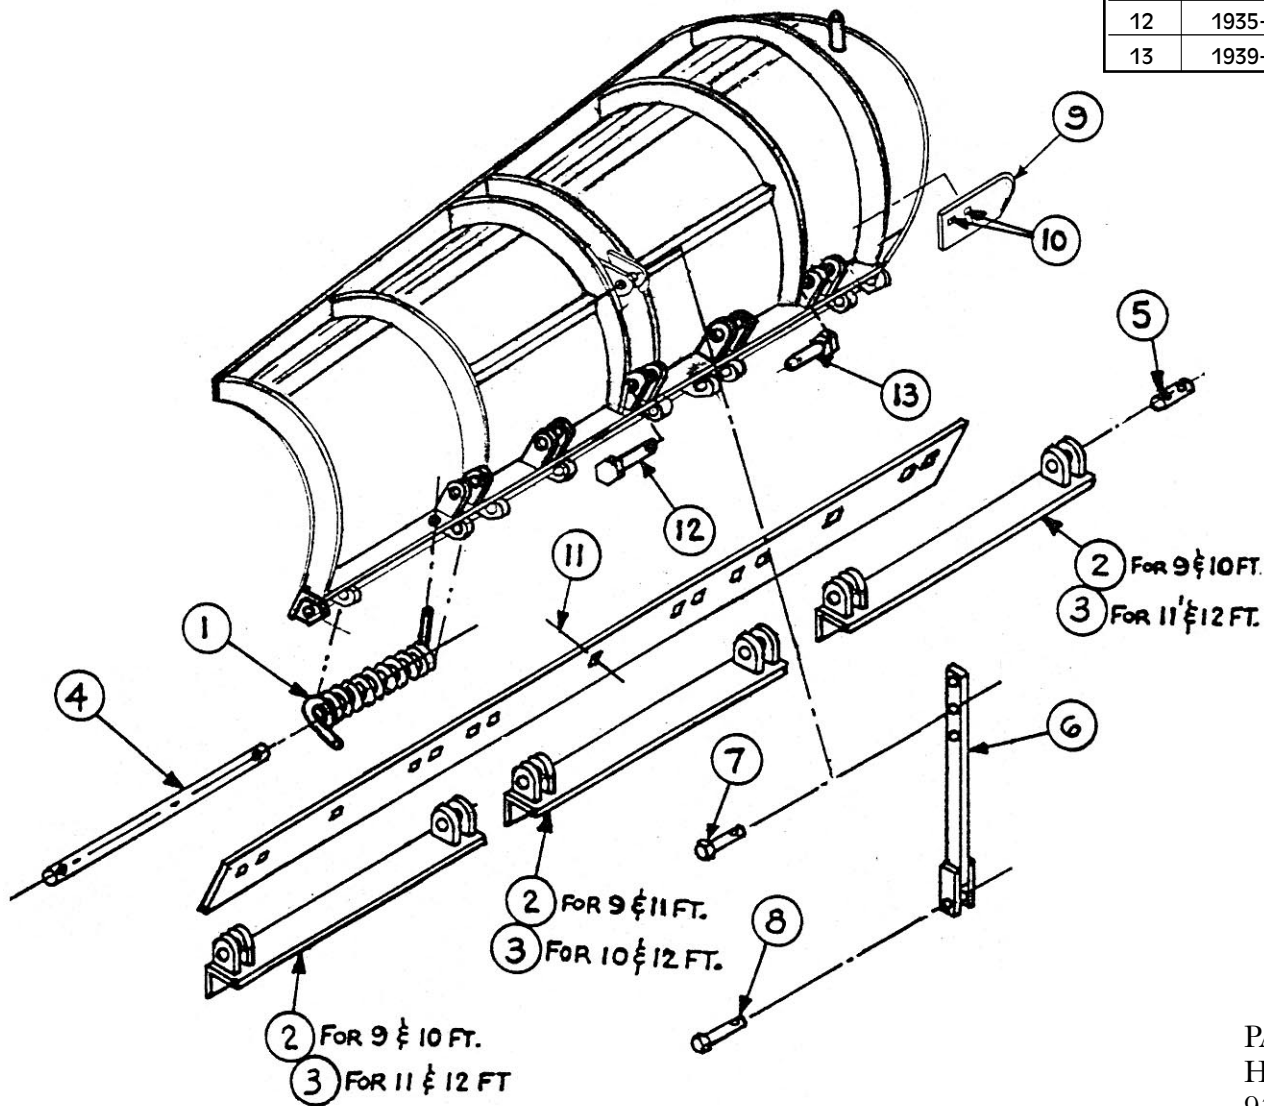

PLOW MODEL	CUTTING EDGE	ITEM 2	ITEM 3
9TBFR	1571-A	REQ'D 3	REQ'D. -
10TBFR	1908-A	" 2	" 1
10HTBFR	1908-A	" 2	" 1
10EHTBFR	1908-A	" 2	" 1
11TBFR	1934-A	" 1	" 2
11HTBFR	1934-A	" 1	" 2
11EHTBFR	1934-A	" 1	" 2
12TBFR	3201-A	" -	" 3
12HTBFR	3201-A	" -	" 3
12EHTBFR	3201-A	" -	" 3


The Gledhill Road Machinery Co.

PARTS DRAWING FOR TBFR,
HTBFR, AND EHTBFR MLBDS.
9'-0, 10'-0, 11'-0 W/ 3-PC. TRIP EDGE PD-1133

ALWAYS INCLUDE
SERIAL NO. OF
PLOW WHEN
ORDERING PARTS

ITEM	PART #	REQ'D.	DESCRIPTION
1	11685-A2	1	1" X 4" PIN ASS'Y
2	11570-B	1	TRIP POST ASS'Y
3	1935-A3	1	1" X 7-1/2" PIN ASS'Y
4	1980-D3	AS REQ'D	TRIP SPRING
5	1939-A4	4	1" X 6" PIN ASS'Y
6	6511-A1 OR A-2	2	CURB SHOE (RT. & LT.)
7	5308-A2	AS REQ'D	CARRIAGE BOLT ASS'Y
8	13174-A	AS REQ'D	TRIP SPRING "J" HOOK
9	1891-A	10	MOLDBOARD PUSH EAR
10	11685-A3	1	1" X 3-1/2" PIN W/COTTER
11	13595-B	2	PLOW MARKERS, STD.


MOLDBD.MODEL#	CUTTING EDGE
10TB	1908-A
10HTB	1934-A
10EHTB	3201-A1
11TB	1908-A
11HTB	1934-A
11EHTB	3201-A1
12TB	1908-A
12HTB	1934-A
12EHTB	3201-A1

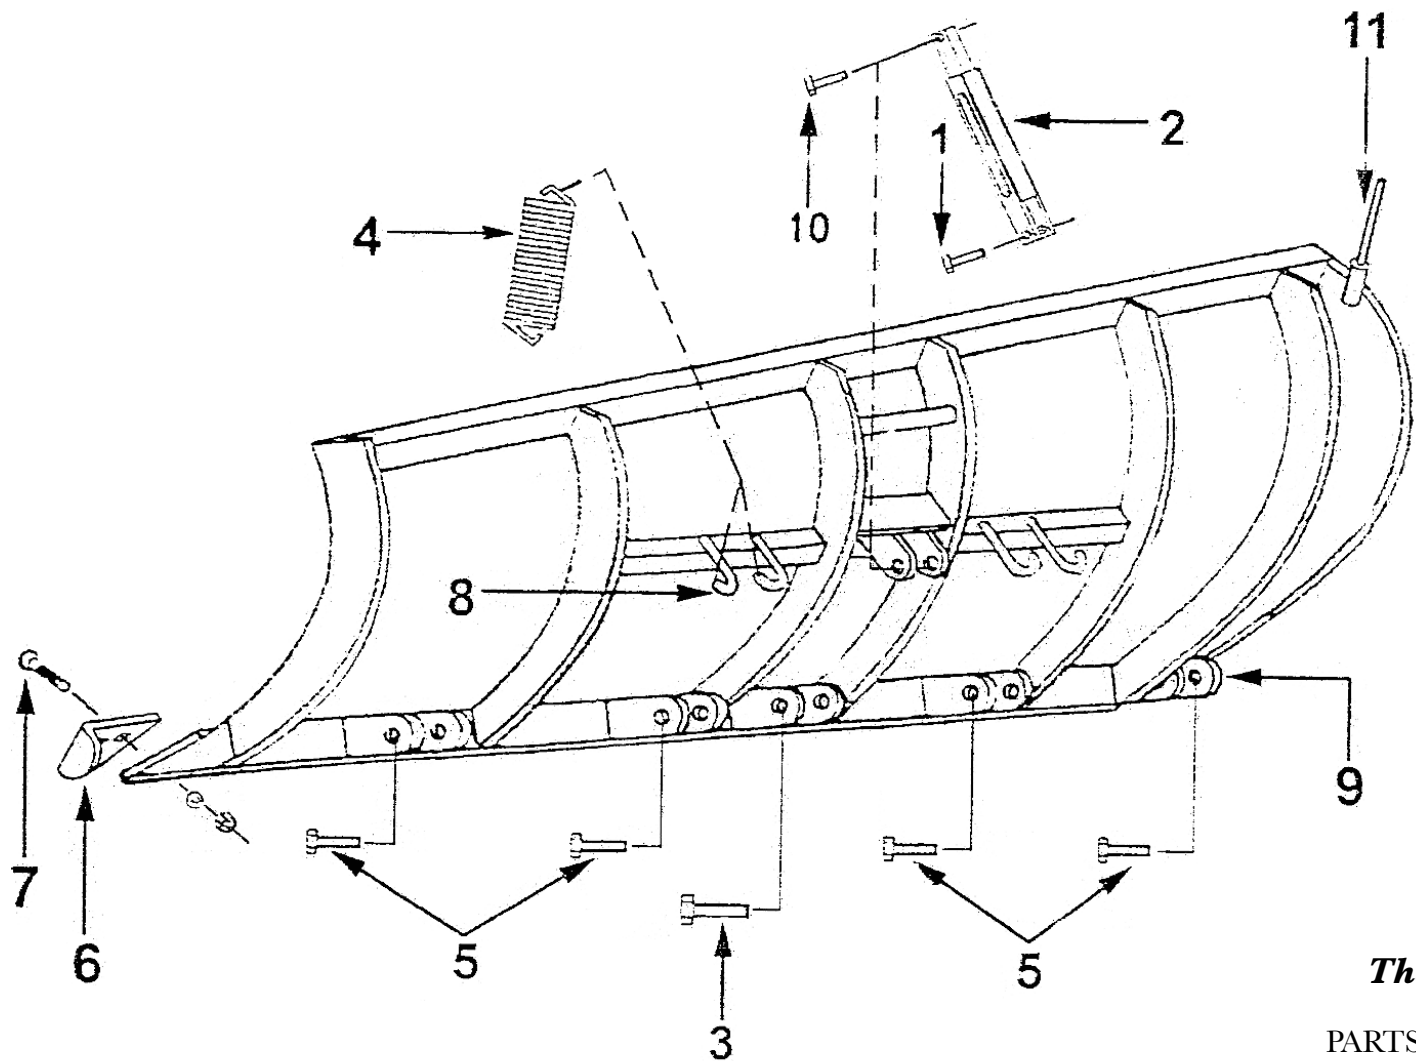

The Gledhill Road Machinery Co.

ALWAYS INCLUDE
SERIAL NO. OF
PLOW WHEN
ORDERING PARTS

ITEM	PART #	REQ'D.	DESCRIPTION
1	1980-D3	AS REQ'D	TRIP SPRING
2	13595-B	1 PAIR	PLOW STRING
3	11685-A2	1	1" X 4" PIN ASS'Y
4	11570-B	1	TRIP POST ASS'Y
5	1935-A3	1	1" X 7-1/2" PIN ASS'Y
6	1939-A4	4	1" X 6" PIN ASS'Y
7	6511-A1 OR A-2	2	CURB SHOE (RT. & LT.)
8	SEE ORDER	AS REQ'D	CARRIAGE BOLT ASS'Y
9	13174-A	AS REQ'D	TRIP SPRING "J" BOLT ASS'Y
10	11685-A3	1	1" X 3-1/2" PIN W/COTTER
11	5463-A	AS REQ'D	BAFFLE BOLT ASS'Y

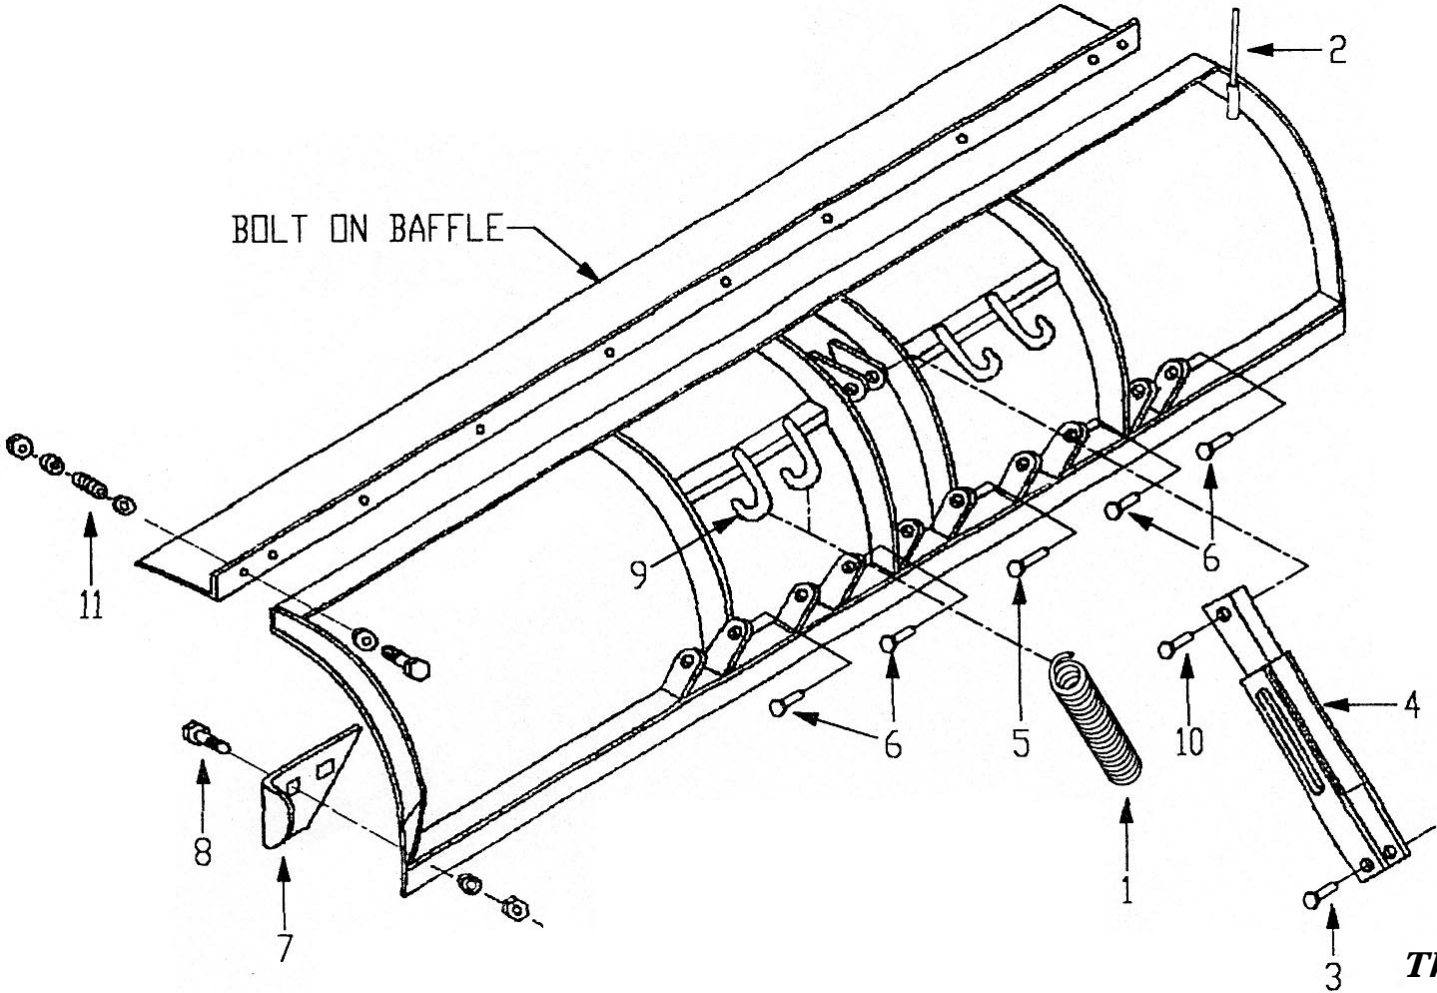

PLOW MODEL	CUTTING EDGE	BAFFLE
9S	1571-A1	2255-A4
9LS	1571-A1	2255-A4
9S	1571-A1	2255-A4
9HS	1571-A1	2255-A4
9EHS	1908-A	2255-A1
10S	1908-A	2255-A1
10HS	1908-A	2255-A1
10EHS	1908-A	1351-A1
11LS	1934-A	1351-A3
11S	1934-A	2255-A3
11HS	1934-A	2255-A3
11EHS	1934-A	2255-A3
12LS	3201-A1	2255-A2
12S	3201-A1	2255-A2
12HS	3201-A1	2255-A2
12EHS	3201-A1	2255-A2


The Gledhill Road Machinery Co.

PARTS DRAWING FOR S, HS
& EHS MOLDBOARDS

PD-1014

ALWAYS INCLUDE
SERIAL NO. OF
PLOW WHEN
ORDERING PARTS

ITEM	PART #	REQ'D.	DESCRIPTION
1	11685-A2	1	1" X 4" PIN ASS'Y
2	11570-B	1	TRIP POST ASS'Y
3	1935-A3	1	1" X 7-1/2" PIN ASS'Y
4	1980-D3	AS REQ'D	TRIP SPRING
5	1939-A4	4	1" X 6" PIN ASS'Y
6	6511-A1 OR A2	2	CURB SHOE (RT. <.)
7	5308-A2	AS REQ'D	CARRIAGE BOLT ASS'Y
8	13174-A	AS REQ'D	TRIP SPRING "J" HOOK
9	1891-A	10	MOLDBOARD PUSH EAR
10	11685-A3	1	1" X 3-1/2" PIN W/COTTER
11	13595-B	2	PLOW MARKERS,STD.

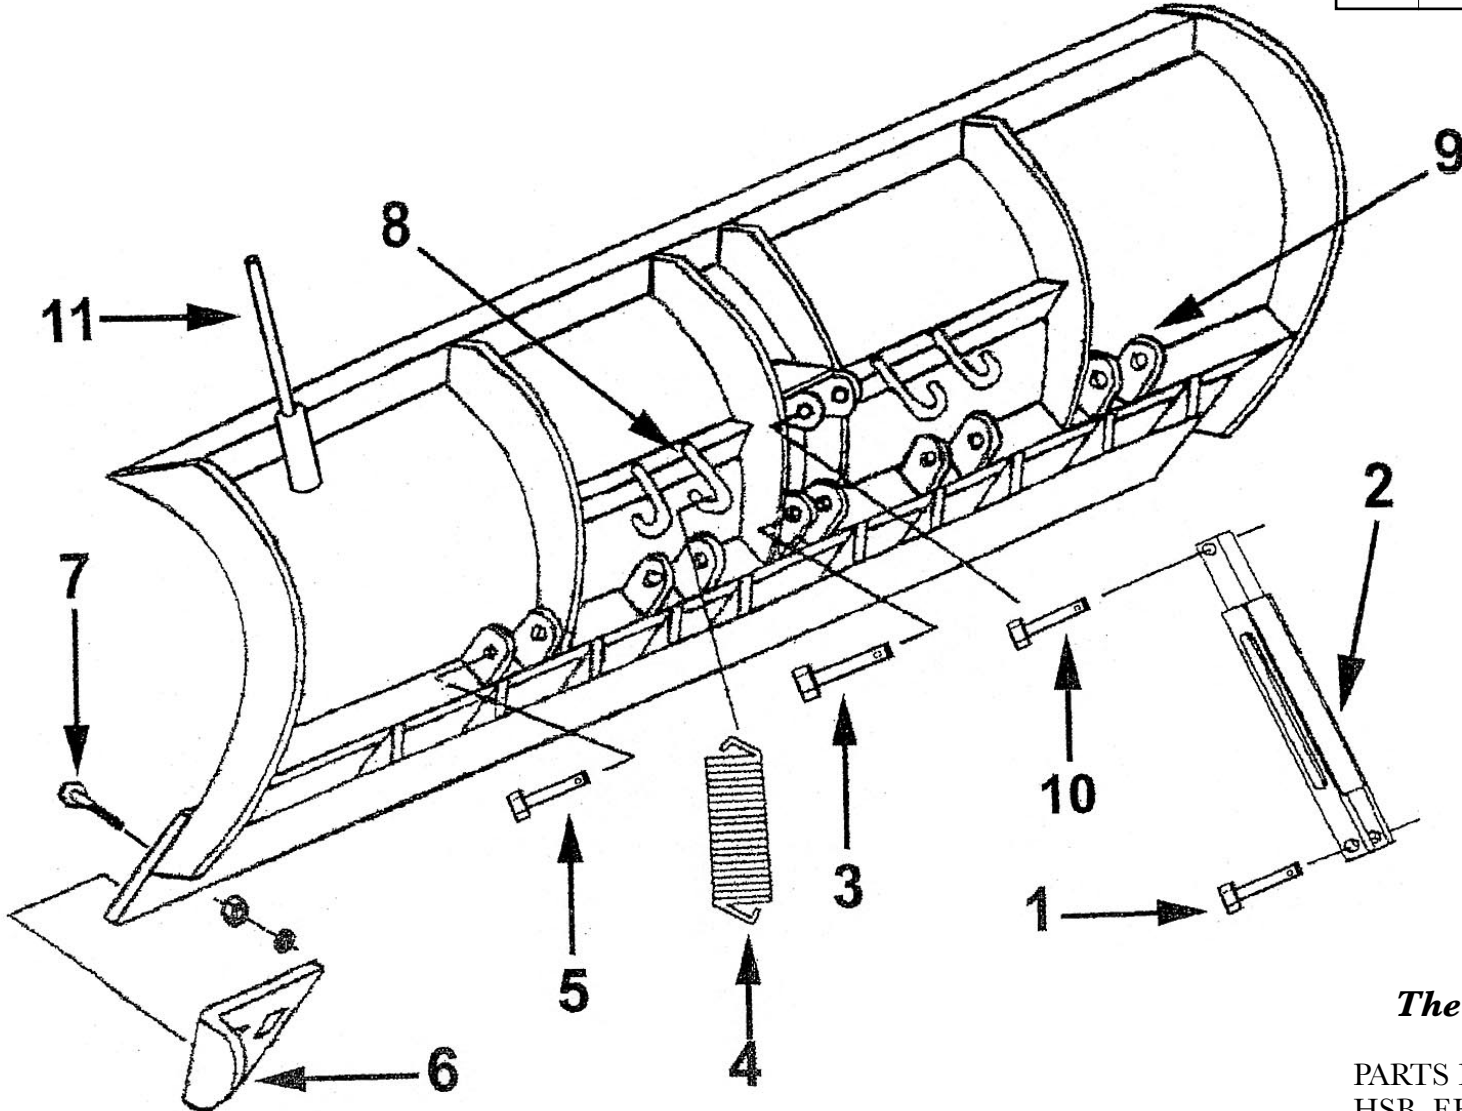


PLOW MODEL	PART #
9SB	13416-D1
9HSB	13406-D1
9EHSB	13417-D1
10SB	13416-D2
10HSB	13406-D2
10EHSB	13417-D2
11SB	13416-D3
11HSB	13406-D3
11EHSB	13417-D3
12SB	13416-D4
12HSB	13406-D4
12EHSB	13417-D4
CUTTING EDGE	PART #
9 FOOT	1571-A1
10 FOOT	1908-A
11 FOOT	1984-A
12 FOOT	3201-A1

The Gledhill Road Machinery Co.

ALWAYS INCLUDE
SERIAL NO. OF
PLOW WHEN
ORDERING PARTS


ITEM	PART #	REQ'D.	DESCRIPTION
1	1980-D3	AS REQ'D.	TRIP SPRING
2	13595-B	1 PAIR	PLOW MARKER
3	11685-A2	1	1"X 4" PIN ASSY.
4	11570-B	1	TRIP POST
5	1935-A3	1	1"X 7-1/2" PIN ASSY.
6	1939-A4	4	1"X 6-1/2" PIN ASSY.
7	6511-A1 OR A2	2	CURB SHOE (RT. & LT.)
8	5308-A41	AS REQ'D.	CARRIAGE BOLT ASSY.
9	SEE ORDER	AS REQ'D.	TRIP SPRING "J" HOOK
10	11685-A3	1	1"X 3-1/2" PIN W/ COTTER
11	5463-A	AS REQ'D.	BAFFLE BOLT ASSY

PLOW MODEL	CUTTING EDGE	BAFFLE
9T	1571-A	5405-C1
10T	1908-A	5405-C3
10HT	1908-A	5405-C5
10EHT	1908-A	5405-C8
11T	1934-A	5405-C3
11HT	1934-A	5405-C6
11EHT	1934-A	5405-C9
12T	3201-A	5405-C4
12HT	3201-A	5405-C7
12EHT	3201-A	5405-C10

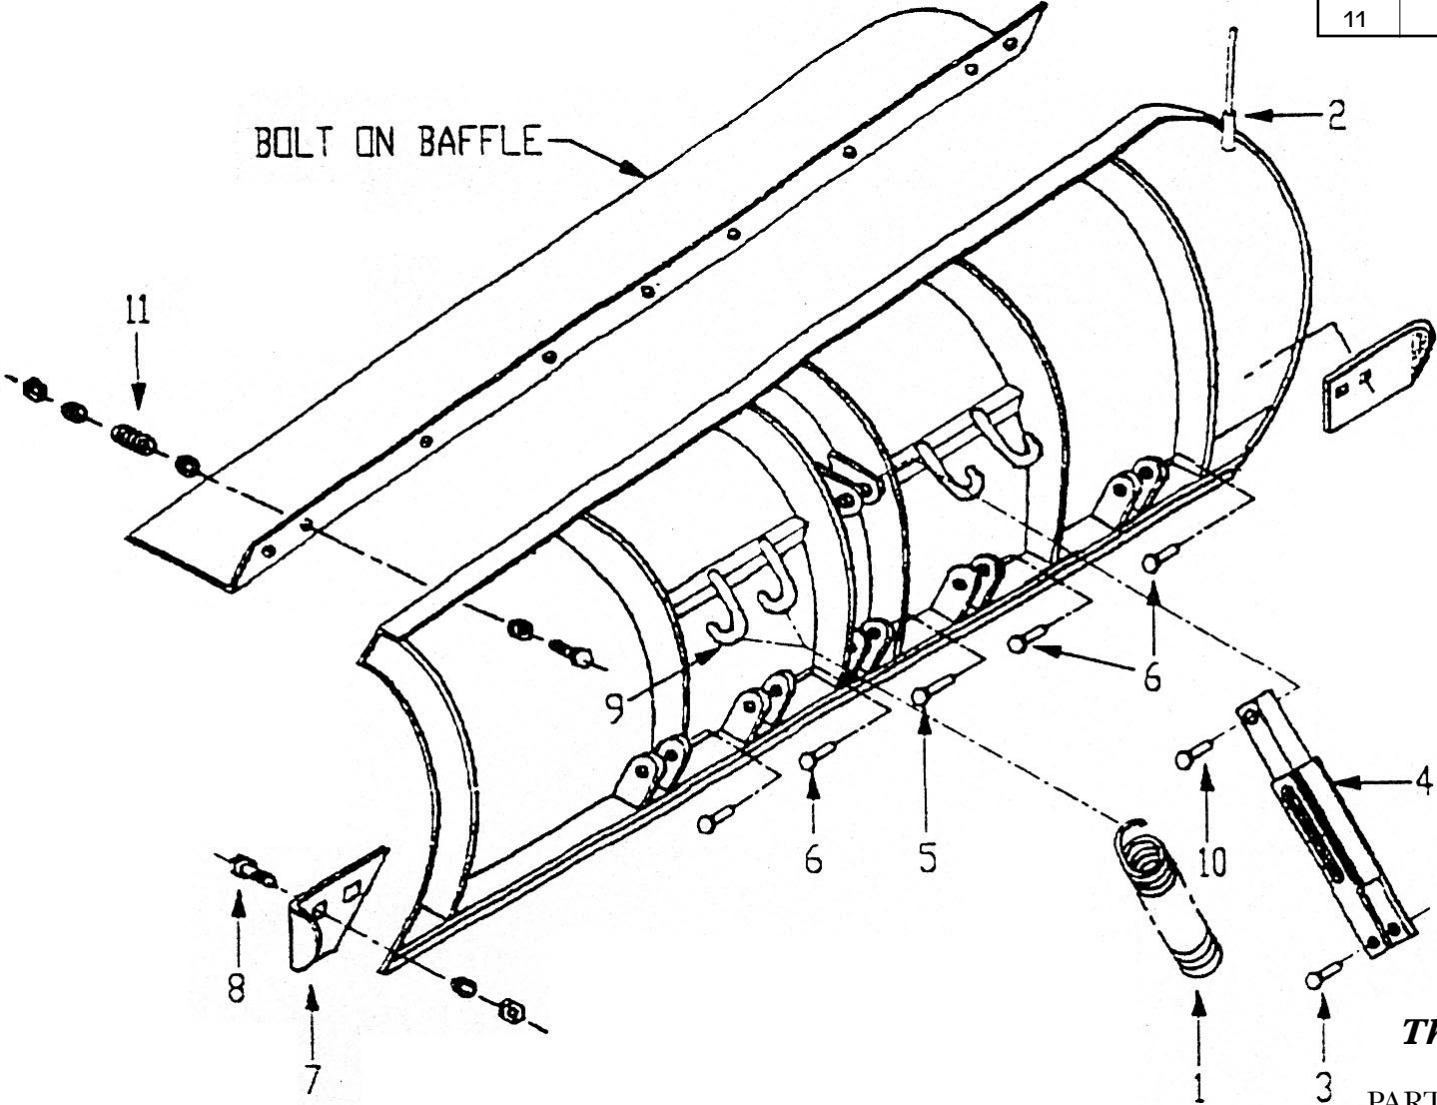

The Gledhill Road Machinery Co.

ALWAYS INCLUDE
SERIAL NO. OF
PLOW WHEN
ORDERING PARTS

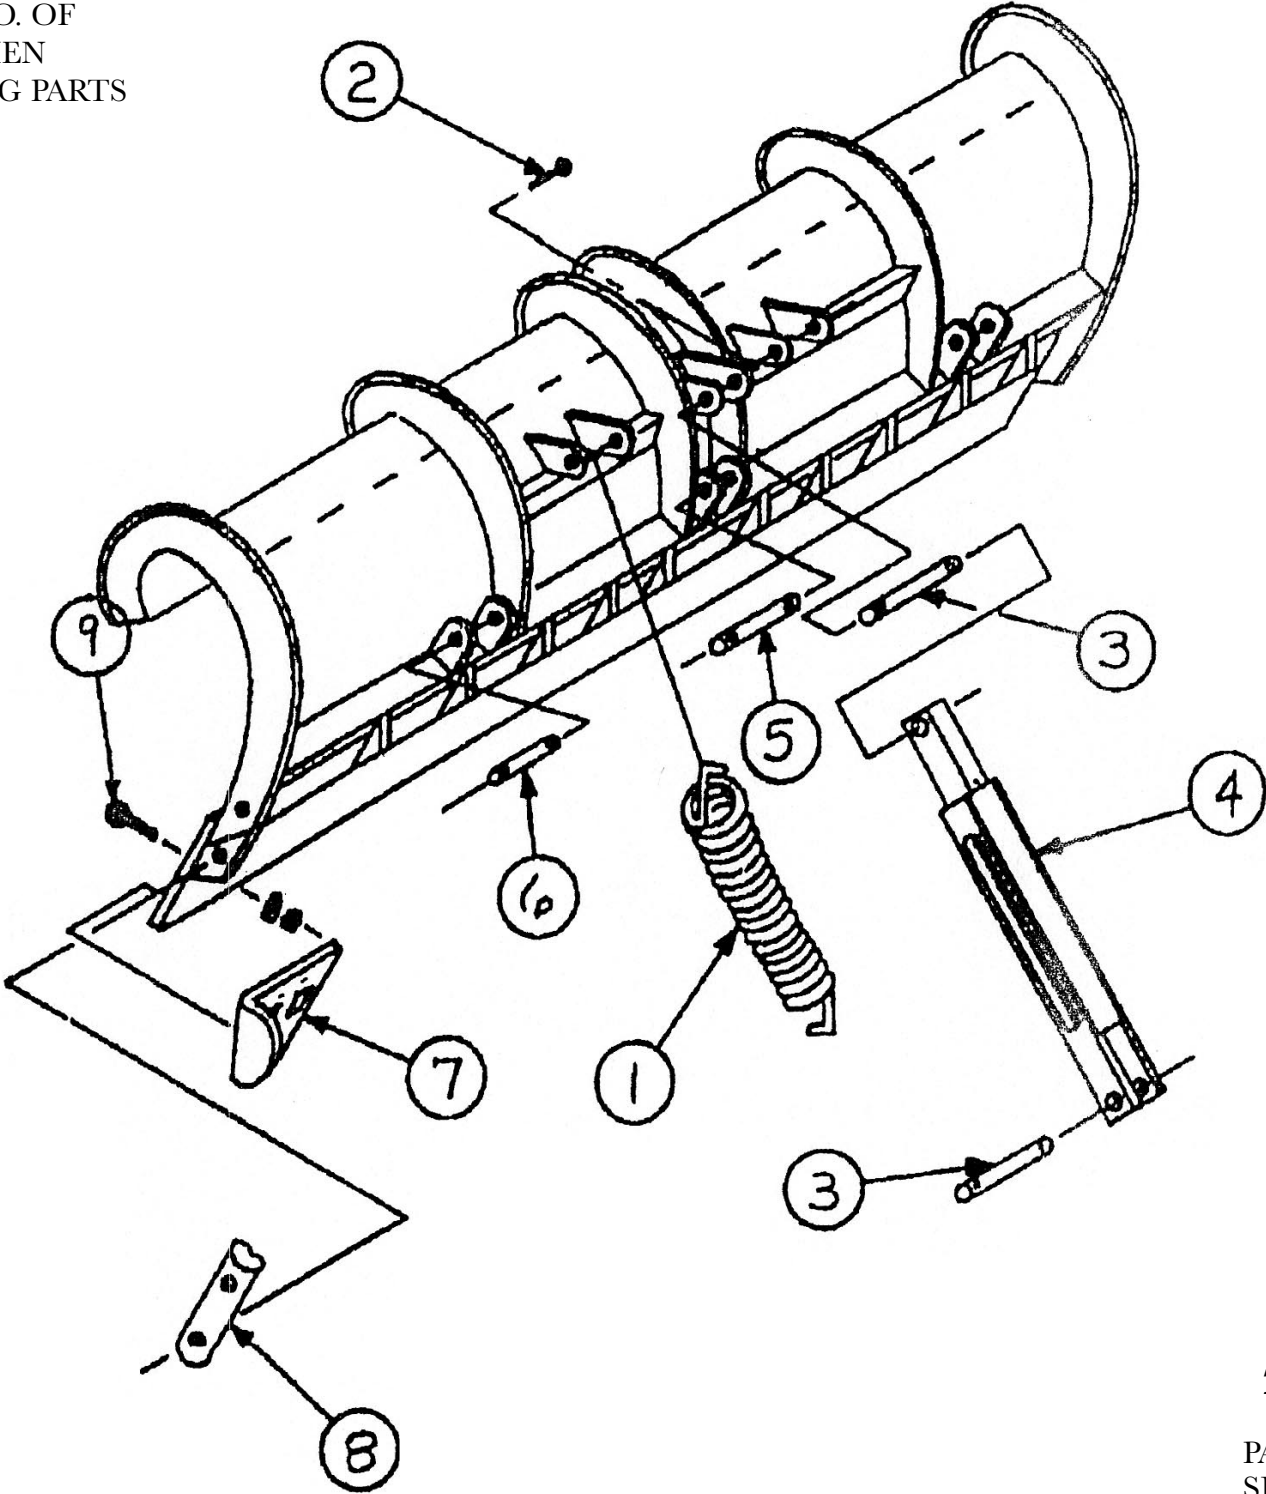


ITEM	PART #	REQ'D.	DESCRIPTION
1	1980-D	1	TRIP SPRING
2	1936-A	1	SPRING PIN
3	5175-A46	1	PIN
4	11570-B	1	TRIP POST
5	1935-A1	1	PIN, (LONG)
6	1939-A2	1	PIN, (SHORT)
7	6511-A	1	OPTIONAL CURB SHOE
8	3927-B	1	OPTIONAL CURB SHOE
9	5308-A2	1	BOLT

PLOW MODEL	PART #
9 SJ	14006-DA
9 HSJ	13999-DA
10 SJ	14006-DB
10 HSJ	13999-DB
11 SJ	14006-DC
11 HSJ	13999-DC
12 SJ	14006-DD
12 HSJ	13999-DD
CUTTING EDGE	PART #
9 FT.	1571-A1
10 FT.	1908-A
11 FT.	1934-A
12 FT.	3201-A

The Gledhill Road Machinery Co.

ALWAYS INCLUDE
SERIAL NO. OF
PLOW WHEN
ORDERING PARTS

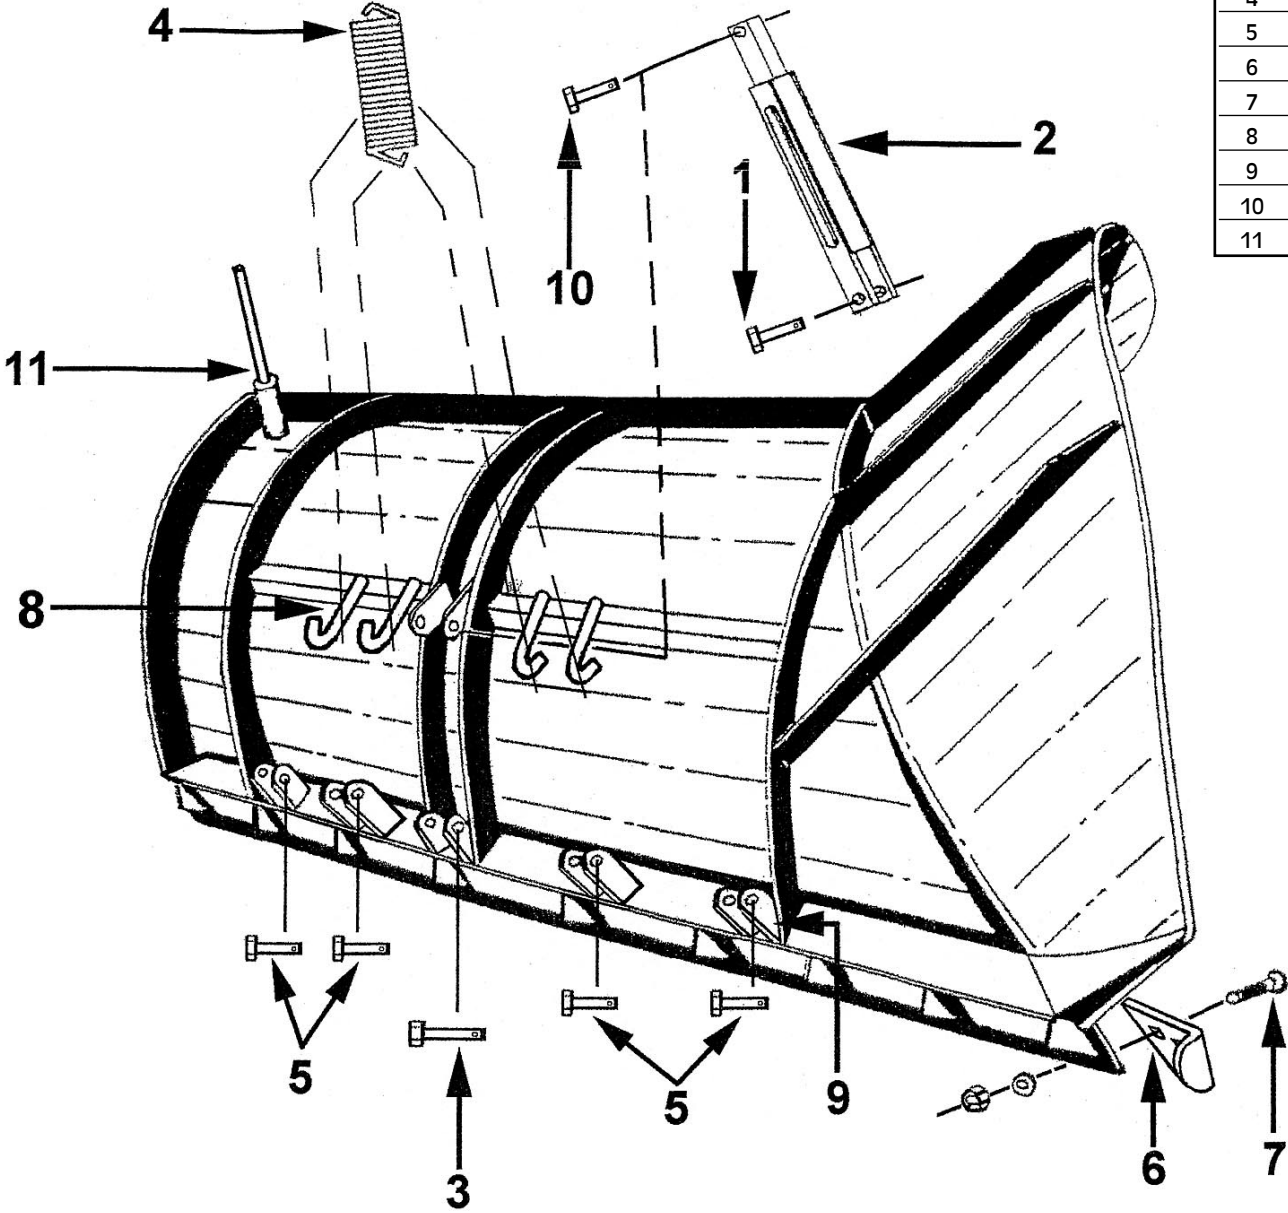


ITEM	PART #	REQ'D.	DESCRIPTION
1	11685-A2	1	1"X 4" PIN ASSY.
2	11570-B	1	TRIP POST ASSY.
3	1935-A3	1	1"X 7-1/2" PIN ASSY.
4	1980-D3	AS REQ'D.	TRIP SPRING
5	1939-A4	4	1"X 6" PIN ASSY.
6	6511-A1 OR A2	2	CURB SHOE (RT. & LT.)
7	5308-A2	AS REQ'D.	CARRIAGE BOLT ASSY.
8	13174-A	AS REQ'D.	TRIP SPRING "J" HOOK
9	1891-A	10	MOLDBOARD PUSH EAR
10	11685-A3	1	1"X 3-1/2" PIN W/ COTTER
11	13595-B	2	PLOW MARKERS

PLOW MODEL	CUTTING EDGE
10R	1908-A
11R	1934-A
12R	3201-A1
10HR	1908-A
11HR	1934-A
12HR	3201-A1
10MR	1908-A
11MR	1934-A
12MR	3201-A1

The Gledhill Road Machinery Co.

ALWAYS INCLUDE
SERIAL NO. OF
PLOW WHEN
ORDERING PARTS

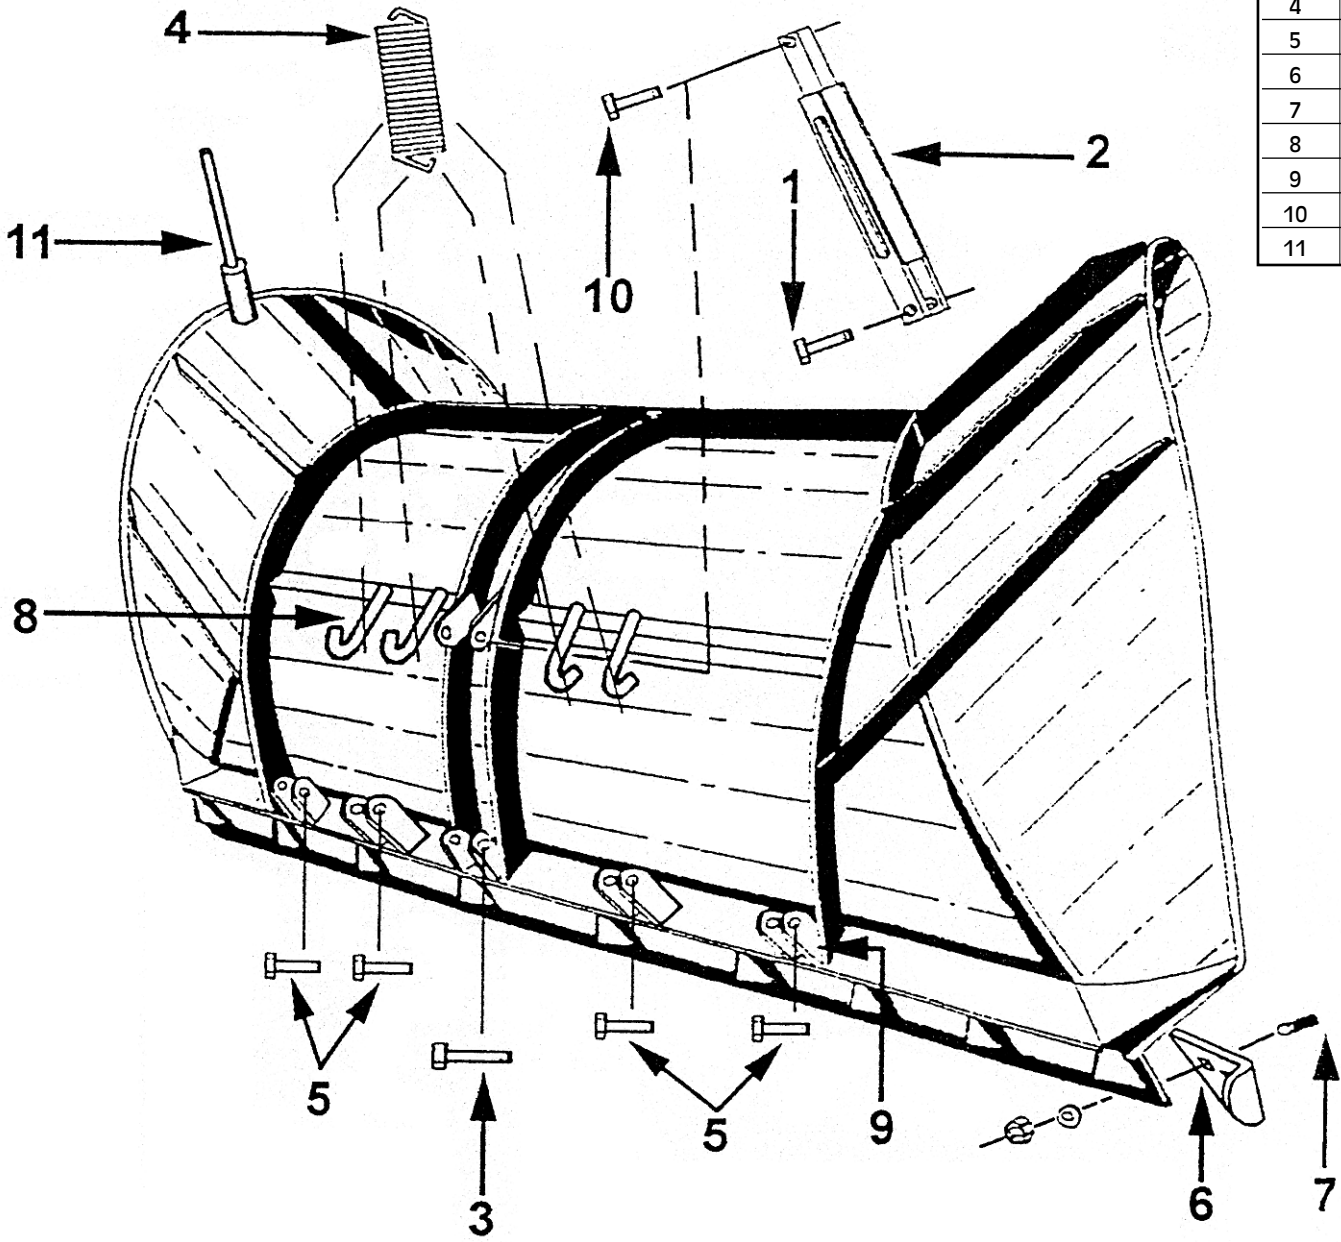

ITEM	PART #	REQ'D.	DESCRIPTION
1	11685-A2	1	1" X 4" PIN ASSY.
2	11570-B	1	TRIP POST ASSY.
3	1935-A3	1	1" X 7-1/2" PIN ASSY.
4	1980-D3	AS REQ'D.	TRIP SPRING
5	1939-A4	4	1" X 6" PIN ASSY.
6	6511-A1 OR A2	2	CURB SHOE (RT. & LT.)
7	5308-A2	AS REQ'D.	CARRIAGE BOLT ASSY.
8	13174-A	AS REQ'D.	TRIP SPRING "J" HOOK
9	1891-A	10	MOLDBOARD PUSH EAR
10	11685-A3	1	1" X 3-1/2" PIN W/ COTTER
11	13595-B	2	PLOW MARKERS

PLOW MODEL	CUTTING EDGE
10R&L	1908-A
11R&L	1934-A
12R&L	3201-A1
10HR&L	1908-A
11HR&L	1934-A
12HR&L	3201-A1
10MR&L	1908-A
11MR&L	1934-A
12MR&L	3201-A1

The Gledhill Road Machinery Co.